








Technical Xtreme Outdoor Fabrics by **Bainbridge** 

- ♦ Fabric width: MAX400 182cm, PR01000 194cm
- ◆ Solution dyed polyester



Black White

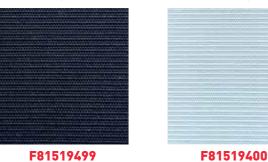

F81519499 F82519499

Silver



F81519460

F82519460


F82519400

F81519490 F82519490



F81519410 F82519410

- ◆ PU coated with Fluorocarbon+ finish
- ◆ MAX400 → 400mm hydrostatic water column PR01000 →1000mm hydrostatic water column\*

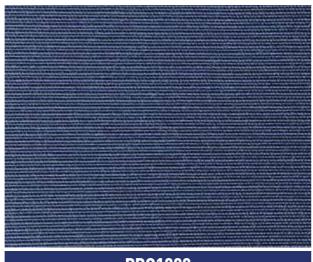

PR01000



F81519494 F82519494




F81519492 F82519492







F81519423 F82519423

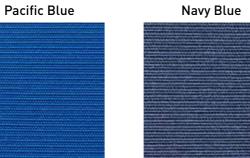

F81519462 F82519462



F81519450 F82519450

# Exceeding the highest requirements for functionality and lifespan








- ◆ Technical ribbed ottoman weave
- ◆ Low weight
- High breathability
- ♦ Water tightness
- ◆ PVC free
- ◆ High UV resistance

- ◆ No colour bleed or rub-off
- ◆ Superb colour fastness
- ◆ Xtreme strength and tear resistance
- ◆ Salt water, oil, dirt and water repellent
- ◆ Flame resistant with an antimicrobial finish

- ◆ Easy handling for storage
- ◆ Fluoro+ finish for dirt and water repellancy
- ◆ Mould resistant
- No stress whitening
- ◆ Dimensionally stable

SolaTX Polyester Technical Data			
	Typical Value		Testing Methods
	MAX400	PR01000	
Water Column	→400mm	→1000mm	ISO 811
Weight	270gsm	280gsm	ISO 3801-1977, Method 5
Roll Width	182cm	194cm	-
Roll Length	50m		-
Material Base	350 dtex Polyester, PU-coating and Fluoro+ finish		-
Colour Fastness	7 Level		DIN EN ISO 105 B02
Tensile Strength	Warp $\rightarrow$ 1500N / 5cm, Weft $\rightarrow$ 1300N / 5cm		DIN EN ISO 13934-1
Elongation	Warp 45%, Weft 30%		DIN EN ISO 13934-1
Tear Strength	Warp →40N, Weft →40N		DIN EN ISO 13937-2
UPF	50+		-
UV-Stability	<b>→</b> 4 - 5		ISO 4892-2 after 2000 h
Flame Resistance	Self-Extinguishing		FMVSS 302

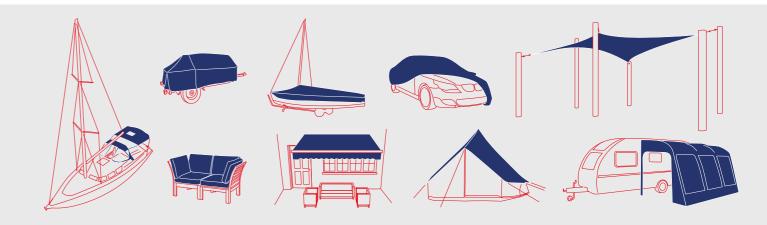







## **CARE & CLEANING**

Proper care and cleaning should be taken to ensure the life of **SolaTX** fabrics.

For regular care and maintenance, the excess dirt should be brushed from the fabric using a soft brush: the fabric should then be sprayed with warm water and air dried.

Periodically, the fabric should undergo a more thorough cleaning. Again, brush the fabric with a soft bristled brush, spray with warm water, then apply a gentle soap. Allow to stand for 10-20 minutes taking care not to let it dry, then rinse thoroughly and air dry.

Do not use detergents and /or solvents.

#### **WARRANTY**

**SolaTX** fabrics are manufactured with only the highest quality raw materials and the most rigorous quality-assurance procedures in Europe.

We offer a 5 year limited warranty on our **SolaTX** solution dyed polyester products.











The technical data is to be considered as indicative. Minor colour variations possible between batches. Ensure only one batch is used per order. Can be sewn or ultra-sonically welded.



### **Bainbridge International Ltd**

8 Flanders Park, Southampton, Hampshire S030 2FZ UK

**T**: +44 (0) 1489 776000

E: info@bainbridgeint.co.uk

W: bainbridgeint.com